

Service Bulletin

Date: March 2004

Bulletin No: 23 002 04 (025)

BMW Motorrad USA

Topic: Ball End Working Loose on Gearshift Lever.
F 650 CS

Subject: The ball end mounted on the inside of the gearshift lever can work loose. In the worst case this may cause the gearbox to shift with difficulty, or not at all.

- Service:**
- 1: Check the security of the ball end on the shift lever.
 - 2: If the threaded ball end is found to have worked loose on the shift lever, remove the entire shift lever and install the modified shift lever with reworked ball end.

The gearshift lever needs to be checked next time the motorcycle is brought in for service.


F 650 CS Motorcycles with the VINs listed below are affected.

Model	Starting VIN	Ending VIN
F 650 CS	ZH 15001	ZH 15607

Warranty: This repair is covered under the terms of the BMW Motorrad USA New Motorcycle Limited Warranty.

Defect Code: 0023070000
Description: Checking / replacing loose Gearshift Lever
Fru: 3

Part Number: **23 41 7 677 932**
Description: New Shift Lever
Qty: 1

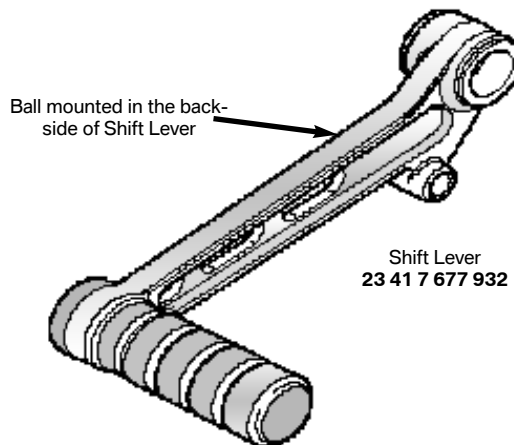

Picture 1

Contact: Pat Raymond
Service and Technical Manager
BMW Motorrad USA

(201) 307 4261
pat.raymond@bmwna.com

